

Authement Iron Works
 (504) 467-6666
www.authement.co

2101 N. Rampart St
Loretta's Pralines



Form 10-1001
revised

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE

CONDITIONS SHEET
Historic Preservation Certification Application




Property name: _____

Project Number: _____

Property address: _____

The rehabilitation of this property as described in the Historic Certification Application will meet the Secretary of the Interior's Standards for Rehabilitation provided that the following condition(s) is/are met:

Extension to 42 inches of 36 inch wrought or cast iron handrail:

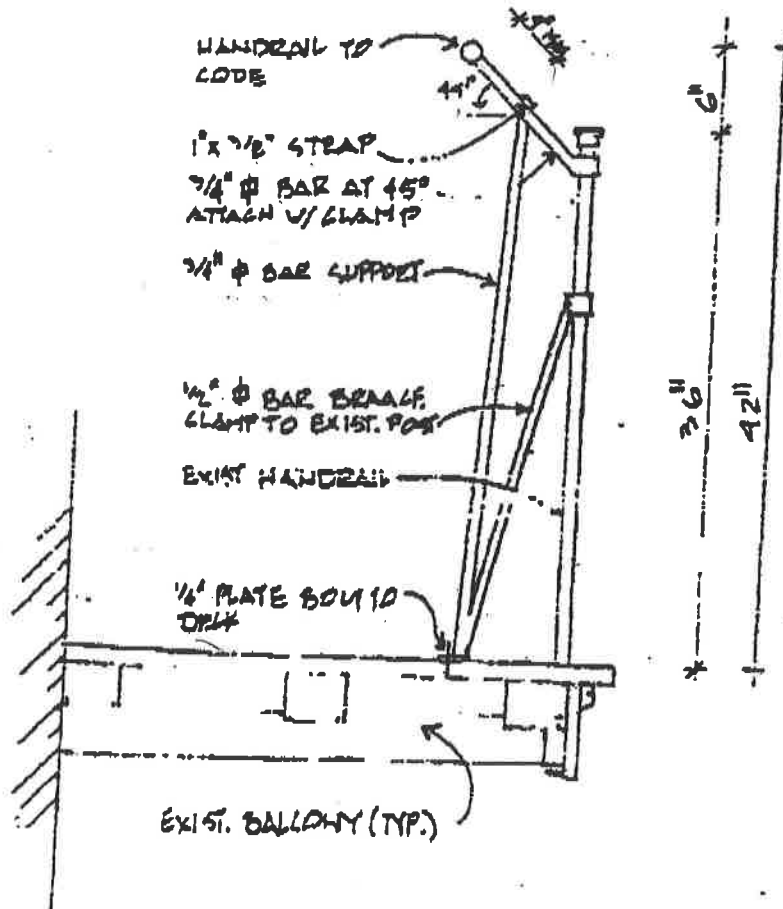

RAILINGS TO BE
MODIFIED TO BE 42"
AS SHOWN

GUARDRAIL MODIFICATION
FOR LIFE SAFETY COMPLIANCE &
LATERAL SUPPORT

1"=1'-0"

(AI)

Date _____ State Signature _____

State Contact Telephone Number _____

The National Park Service has determined that this project will meet the Secretary of the Interior Standards for Rehabilitation if the condition(s) listed in the box above are met.

Date _____ National Park Service Signature _____

RAILINGS TO BE
MODIFIED TO BE 42"
AS SHOWN




- GENERAL NOTES:**
1. GRIND ALL WELDS SMOOTH AND PRIME IMMEDIATELY TO PREVENT RUST.
 2. HAND SCRAPE OR LIGHTLY GRIND ALL UNPAINTED OR PEELING PAINT; PRIME.
 3. PAINT ENTIRE HANDRAIL ASSEMBLY PER VCC - APPROVED PAINT SCHEDULE.
 4. NO SPRAY PAINTING SHALL BE ALLOWED ON THE EXTERIOR OF THE BUILDING.

EXISTING 1/2" DIA. BACKBRACE

NEW TOP RAIL, GALVANNEUM
1/2" SQUARE STEEL BAR WITH CAP RAIL TO MATCH EXISTING. ALIGN VERTICAL SUPPORTS AS SHOWN. SECURE TO BACK OF EXISTING WITH 1/2" BAR AT TOP AND BOTTOM RAILS. SECURE TO DECK WITH 3/4" GALV. SCREWS THRU 1/4" BOTTOM PLATE (TYP)

EXISTING HANDRAIL:
REPAIR BROKEN CAST PANELS AS REQUIRED BY GILD WELD. REPAIR STEEL COMPONENTS AS REQUIRED BY ARC WELD OR MECHANICAL FASTENERS TO MATCH EXISTING CONNECTIONS.

NEW BOTTOM RAIL (CONTINUOUS)

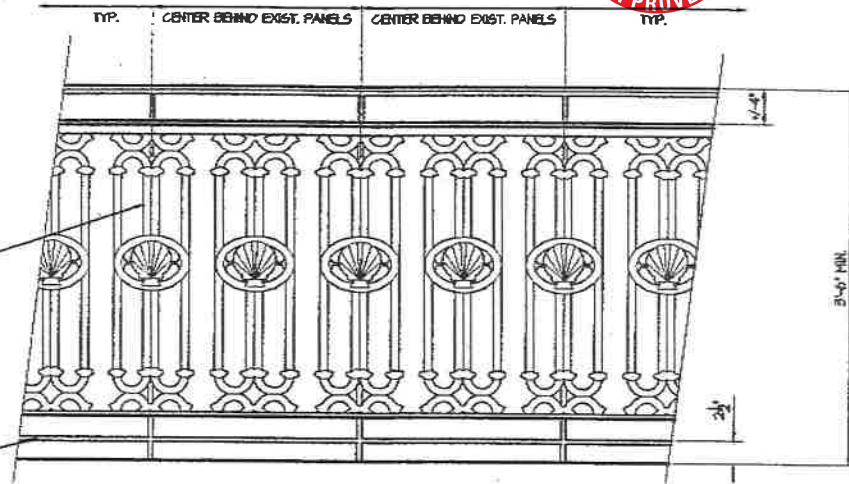

Scale 3/4" = 1'-0"